

Date:
May 26, 2011

Technical Newsletter

No:
37




www.grindex.com

Subject:
Improved impeller design on Master H 60Hz

Dear Distributor,

The impeller design is improved on model Master H in 60Hz. The diameter on the upper impeller disc is increased so it covers the most exposed area on the seal cover housing

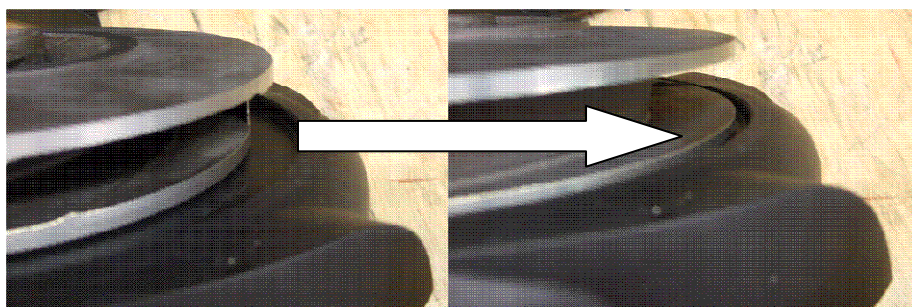

Reason for change

Improved wear resistance when pump is running in snore operation with high concentration of abrasives.

Pump concerned

Master 8105.181

Time for change

The change is implemented from July 2011 from serial number 1150001 (For example 8105.181-1150001)

Spare parts

New Part number

Denomination	Part number
Impeller H 60Hz	5101654

Replaced part number

Denomination	Part number
Impeller H 60Hz	5101652

Spare part lists will be updated ASAP

Interchangeability

The new impeller is fully replacing the old impeller

Yours sincerely,

Jonas Bladh

Technical Support